

INDUSTRIAL NOISE VIBRATION & THERMAL MANAGEMENT SOLUTIONS

Installation Instructions

ANTI-VIBRATION PRODUCTS | EXPANSION COMPENSATORS | FLEXIBLE CONNECTORS | ACOUSTIC PRODUCTS | THERMAL INSULATION

ANTI-VIBRATION PRODUCTS OS1E-HD/IL Restrained Spring Mount

Before installation please carefully review the data below to ensure your equipment and installation environment does not exceed the products limitations.

Operating Temperature Range: -20°C to +80°C

NOTE - Failure to install the correct mount may result in the potential failure of the anti-vibration mount.

NOTE - These mounts should only be used in compression, never in tension or shear.

AVM Variant	Load Kg / (N)	Colour Code	AVM Variant	Load Kg / (N)	Colour Code
OS1E-HD/IL-320-LG	320 / (3139)	Light Green	OS1E-HD/IL-800-YW	800 / (7848)	Yellow
OS1E-HD/IL-400-OR	400 / (3924)	Orange	OS1E-HD/IL-850-LB	850 / (8339)	Light Blue
OS1E-HD/IL-500-MB	500 / (4905)	Medium Blue	OS1E-HD/IL-920-PK	920 / (9025)	Pink
OS1E-HD/IL-550-WH	550 / (5396)	White	OS1E-HD/IL-1050-GY	1050/(10301)	Grey
OS1E-HD/IL-600-GN	600 / (5886)	Green	OS1E-HD/IL-1200-BU	1200 / (11772)	Blue
OS1E-HD/IL-650-RD	650 / (6377)	Red	OS1E-HD/IL-1350-BK	1350 / (13244)	Black
OS1E-HD/IL-750-PR	750 / (7358)	Purple	OS1E-HD/IL-1600-DB	1600 / (15696)	Dark Brown

<u>STEP 1</u>

Ensure the correct anti-vibration mounts has been selected for the application and are undamaged.

Place on a level surface and remove the upper fixing screw and washer from each anti-vibration mount before positioning in the desired locations beneath the equipment to be isolated.



<u>STEP 2</u>

Line up the holes in the base of the equipment with the threaded holes in the anti-vibration mounts.

Proceed to lower the equipment down onto the anti-vibration mounts.

<u>STEP 3</u>

It will be noted that each mount will have deflected by a varying amount due to the static loads applied.

Before levelling the equipment, loosely re-insert the upper fixing screw and washer onto each anti-vibration mount.






STEP 4

Each anti-vibration mount should now be bolted down to a level floor surface or supporting structure using the two open-ended slots located on the baseplate.



STEP 5

The levelling process should start with the mount that has deflected the greatest and continuing in ascending order until the equipment is level. This process is achieved by turning the levelling screw located underneath the top plate, allowing the equipment to be raised to the desired level.

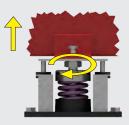

STEP 6

Further adjustment and maintenance should not be required.

However we do recommend that visual inspections take place to check for accidental damage or misuse.



www.isolatedsystems.com